

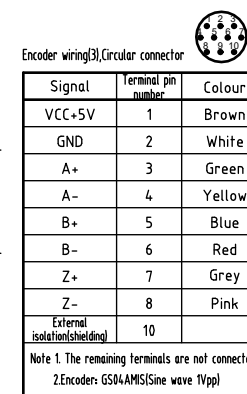
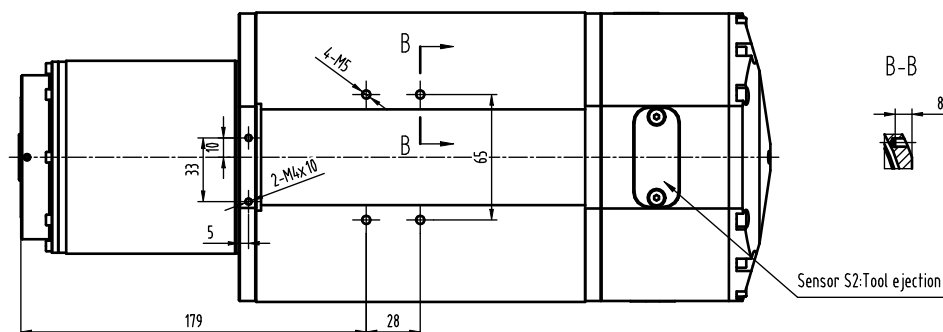


Wiring instructions for sensors	
Sensor S1 (Tool lock detection)	Brown cable: +24V DC power supply
	Black cable: signal output (PNP normally open)
	Blue cable: 0V DC power supply
Sensor S2 (Tool release detection)	Brown cable: +24V DC power supply
	Black cable: signal output (PNP normally open)
	Blue cable: 0V DC power supply

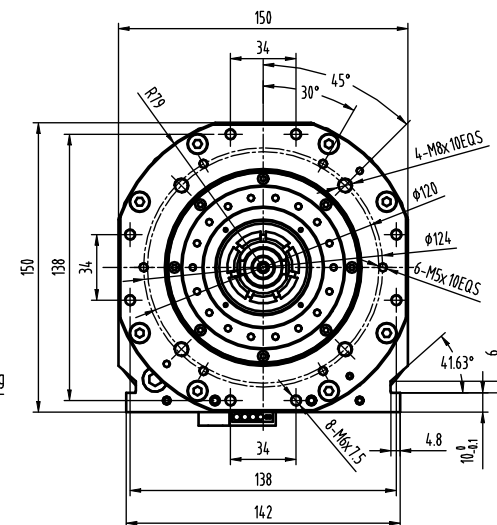

Rated Power: 20-20kW S1
Rated Voltage: 380-380V
Rated Rotation: 10800-18000r/min
Rated Frequency: 360-600Hz
Rated Current: 45-45A
Number of Pole: 4P
Rotating Direction: Counterclockwise viewed from
the end of spindle extension
Cooling Method: Water cooling
Tool Holder: HSK-63E
Weight: Approx 27kg

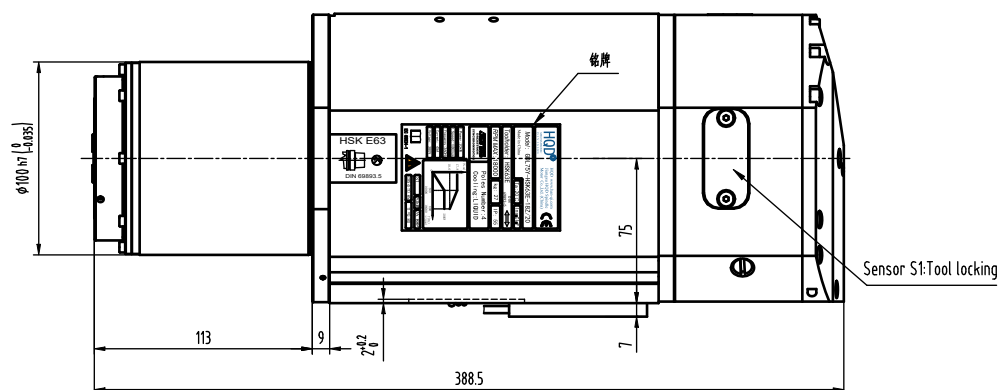

						江苏翰琪电机股份有限公司								
									外形图					
												GDL75Y-HSK63E-18Z/20-00-1		
标记	处数	分 区	更改文件号	签 名	年、月、日									
设 计			标准化			阶段标记	重量	比例						
审 核						S		1:2.75						
工 艺			批 准											

借 (通) 用 件 登 记	
旧底图总号	
底 图 总 号	
签 字	
日 期	
档案员	日 期